




TAKE DOWN FEATURE FINIAL F43 DOWN TO BASE OR UNTIL LINE OF STABILITY IS REACHED PRIOR AND REBUILD AS METHOD STATEMENT. THE METHOD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWING TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.

UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.

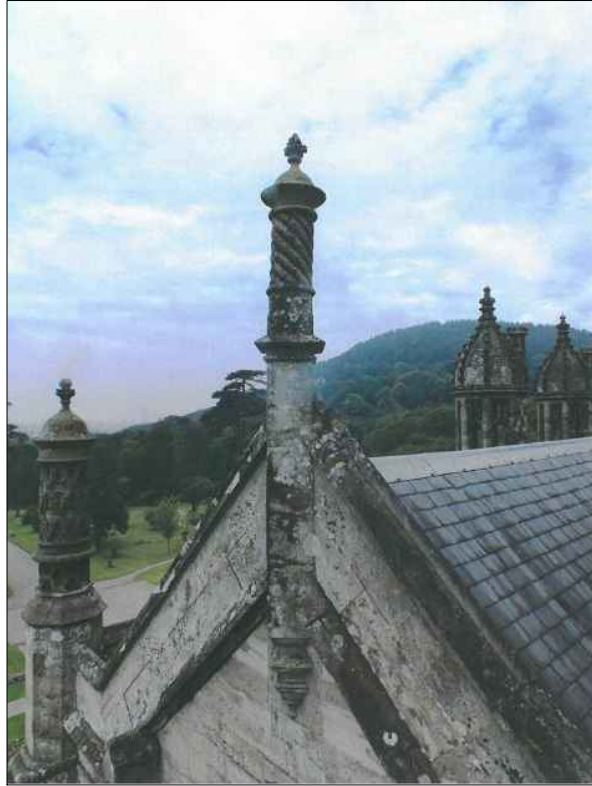

TAKE DOWN FEATURE FINIAL F44 DOWN TO 1100MM BELOW THE TOP AND DOWEL INTO LOWER STONE AS METHOD STATEMENT. THE METHOD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWING TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.


UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.



REMOVE ROOT GROWTH FROM VEGETATION AND REPOINT. REPAIR MORTAR FLAUNCHING AROUND CHIMNEY POTS. METHOD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWING TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.

UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.

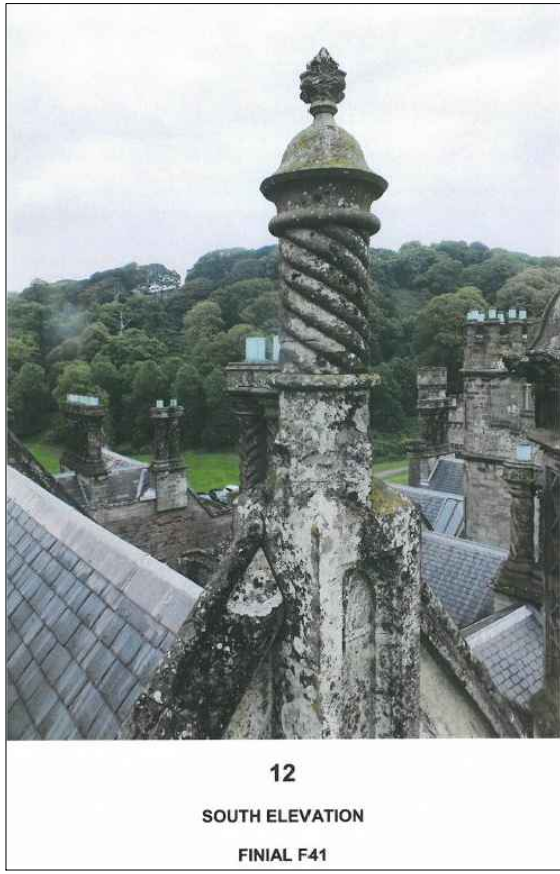

REFIT LOOSE CROCKET STONE AS METHOD STATEMENT. THE METHOWD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWING TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.

UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.



REMOVE DOMED CAPPING TO FINIAL F50 AND REBED TO STONEMWORK BELOW AS METHOD STATEMENT. THE METHOD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWINGS TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.

UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.



REFIT LOOSE CROCKET STONE TO FINIAL F38 AND DOWEL INTO LOWER STONE AS METHOD STATEMENT. THE METHOD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWING TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.

UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.



DISMANTLE CAPPING STONE AND REBED. REPOINT GAPS BETWEEN STONEMWORK AND REPLACE MISSING STONE AS METHOD STATEMENT. THE METHOD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWING TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.

UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.



DISMANTLE 2.00M HIGH FINIAL F37 AND REBUILD AS METHOD STATEMENT. THE METHOD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWING TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.

UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.



REFIT LOOSE CROCKET STONE TO FINIAL F47 AND DOWEL INTO LOWER STONE AS METHOD STATEMENT. REMOVE AND KILL IVEY WITH HERBICIDE. THE METHOD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWING TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.

UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.



CUT IVEY STEMS TO FINIAL F57 AND SPRAY WITH HERBICIDE. REPOINT GAPS WITH MORTAR AS METHOD STATEMENT. THE THE METHOD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWING TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.


UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.



DISMANTLE DOME UNTIL LINE OF TWIST AND REBUILD AS METHOD STATEMENT. THE METHOD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWING TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.

UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.

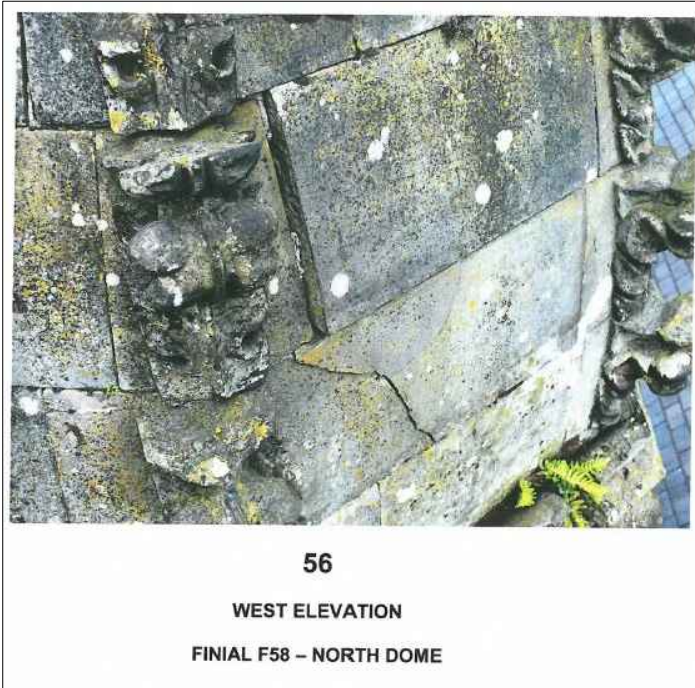

CHECK INTERNAL LINING AS EVIDENCE OF BRICKS ON FLOOR. REPOINT GAPS IN MORTAR AS METHOD STATEMENT. THE METHOD STATEMENT MAY NEED TO BE REVIEWED AND REVISED ONCE WORK TO STONEMWORK IS OPENED UP

DRAWING TO BE READ IN CONJUNCTION WITH METHOD STATEMENT AND DRAWING 7081/BS/0219/01.

UNFORSEEN WORKS TO BE REPORTED TO THE SUPERVISING OFFICER FOR CONSULTATION WITH CADW.

NOTES

1. All dimensions in millimetres unless otherwise stated.

Rev	Details	Dr	Ch	Apr	Date



Neath Port Talbot
Castell-nedd Port Talbot
County Borough Council Cyngor Bwrdeistref Sirol
Making a difference Gwahaniaeth er gwell

PROPERTY & REGENERATION
Gareth Nutt B.Sc(Hons), M.Sc., DMS, FRICS
CORPORATE DIRECTOR OF ENVIRONMENT
THE QUAYS, BRUNEL WAY
BAGLAN ENERGY PARK SA11 2GG
www.npt.gov.uk

Project

Margam Castle
Margam Country Park
PortTalbot

Drawing Title

South and West Elevations
Gable and Finial Repairs Phase 2

File No.	Property Ref. No.			
Drawn	GH	Checked		Approved
Date		Date		Date
Scales	NTS			
Drawing No.	7081/BS/0219/02			Rev.

THIS IS A C.A.D. PRODUCED DRAWING AND SHOULD NOT BE AMENDED BY HAND.