

10.0 Appendix 3 - Tree Survey Data Key

- **Tree ID #** - Identifies the location of individual trees (T-ID Number), Groups of trees (G-ID Number), Area of trees (A-ID Number), Hedgerow (H-ID Number), Woodland (W-ID Number), Row of trees (R-ID Number) and tree Stumps (S-ID Number) on the accompanying plan. *(Please note: A group of trees here refers to two or more standing trees that form a visual whole, whereas an area of trees refers to dispersed individual trees standing within the site)*
- **Tree Species** - Scientific names and common tree name in brackets are generally shown.
- **Age**
 - o (Y) Young – Less than 1/3 of life completed
 - o (SM) Middle Aged - 1/3 - 2/3 of life completed
 - o (EM) Early Mature – Just entering Maturity
 - o (M) Mature – more than 2/3 of life completed
 - o (OM) Over Mature - more than 3/3 of life completed and declining
 - o (V) Veteran - (v) Veteran – Veteran trees have no precise definition but are trees considered to be of biological aesthetic or ecological value because of their age
- **Stems** – Number of tree stems used to calculate the RPR/RPA
- **Stem Diam** (mm) - Diameter of tree stem measured in millimetres for single stem trees or average stem diameter calculated for multi-stemmed trees as detailed in section 4.6 & Annex C of the British Standard 5837:2012, Trees in relation to design, demolition and construction - Recommendations. The height above ground level where the stem measurement was taken will be shown if not measured at 1.5 metres above ground level. *(Please note: that the stem diameter of certain trees will have to be estimated due to difficulties in taking measurements or for trees with a large number of stems)*
- **Cat** – Tree Quality Category - British Standard 5837:2012 A, B, C, U + 1, 2, 3

Based on BS5837:2012 categories A, B, C, U provides the basis of prioritising trees for retention:

- o A – Those of high quality with an estimated remaining life expectancy of at least 40 years. (*Most desirable for retention*)
- o B - Those of moderate quality with an estimated remaining life expectancy of at least 20 years. (*Desirable for retention*)
- o C – Those of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm. (*Optional for retention*)
- o U – Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years. (*Unsuitable for retention unless provides high conservation value*)

Retention Criteria Subcategories: Used for identifying subcategories

E.g. A2 = A high quality tree with a high landscape qualities (further details can be found in British Standard 5837:2012, Trees in relation to design, demolition and construction - Recommendations UK; British Standards Intuition)

- o 1 – Mainly Arboricultural qualities
 - o 2 – Mainly landscape qualities
 - o 3 – Mainly cultural values, including conservation
- **Height + (Lower Branch Height)** - Tree height in metres and in brackets height in metres of the crown (tree branches) clearance at its lowest point above adjacent ground levels.
- **Nrth, Est, Sth, Wst** - Crown Spread (Metres) -Tree branch spread in metres measured in four directions (North, East, South, West) from the trunk.
- **Phys Cond** - Physiological Condition Indicating the health of the tree -
 - o (G) Good
 - o (F) Fair
 - o (P) Poor
 - o (D) Dead
- **Struc Cond** – Structural Condition indicting the structural integrity of the tree -
 - o (G) Good – No, or remediable physical defects or decay
 - o (F) Fair - Physical non-remediable defects or decay present, not presenting imminent danger but should be monitored
 - o (P) Poor - physical non-remediable defects or decay present, tree liable to imminent collapse or loss of major limbs.
 - o (D) Dead
- **Est. Remain Contrib - (<10, 10+, 20+, 40+)**

The trees estimated remaining contribution in years, recorded as:

 - o <10 – less than 10 years
 - o 10+ – at least 10 years
 - o 20+ – at least 20 years
 - o 40+ – at least 40 years
- **Comments** – Additional Comments if required
- **Preliminary Management Recommendations** – Work Recommendations, including further investigation of suspected defects that require more detailed assessment and pose potential for wildlife habitat.

- **Work Priority** - Work Priority -This gives a work priority rating of preliminary management for each tree.
 - o H - High – Urgent work to be carried out as soon as practicable due to safety reasons (Within 14 days).
 - o H/M – High - Medium – Work to be carried out within 6 months/or before construction phase begins
 - o M - Medium – Work to be carried out in 12 months
 - o L - Low – After consideration/Re-inspect in 18-24 months
 - o Blank – No work required.
- **RPR** – Root protection radius / **RPA** - Root Protection Area - Is a layout design tool indicating the minimum area around a tree deemed to contain sufficient roots and rooting volume to maintain the tree's viability, and where the protection of the roots and soil structure is treated as a priority. RPR is a circular area measured as a radius in metres from the centre of the tree or RPA is an area in metres squared. Where required this area may be changed in shape but not reduced in area whilst providing adequate protection of the tree's rooting system.

10.0 Appendix 4 – Tree Protection Plan

Trees for removal to be identified from the drawing and marked by an arboriculturist.

No vehicles to enter the grass verge or root protection zone during tree removal or fencing installation/removal.

Fencing to be installed prior to any construction works (including demolition, materials delivery, works compound installation).

The location of the tree protective fencing is indicative only and must not be directly measured from this plan. Its true location must be surveyed accurately on site and where applicable be measured from the tree centre by the stated dimension value.

Fencing to remain in place until all construction works have ceased.

6.2.2.1 - Barriers

6.2.2.1 - Barriers should be fit for the purpose of excluding construction activity and appropriate to the degree and proximity of work taking place around the retained tree(s). Barriers should be maintained to ensure that they remain rigid and complete.

6.2.2.2 - The default specification should consist of a vertical and horizontal scaffold framework, well braced to resist impacts, as illustrated in Figure 2. The vertical tubes should be spaced at a maximum interval of 3m and driven securely into the ground. Onto this framework, welded mesh panels should be securely fixed.

The fencing will comprise of standard G57/Heras styled steel self-supporting security fencing panels. The panels must be securely clamped together. They must be secured to the ground with robust steel stakes to a depth of 600mm. These are securely clamped to the panels. **The use of steel mesh panels in conjunction with just clamps and self supporting bases is not acceptable for use.** They must be secured to the ground with stakes to prevent movement. Where stated, additional bracing of the panels must use angled scaffolding poles to prevent further movement (see diagram).



- The major cause of damage to trees on construction sites is due to soil compaction.
- Roots use the spaces between soil particles to obtain Oxygen, Water and Nutrients.
- Heavy plant and machinery compresses (compacts) the soil, squashing out the air spaces and preventing root function.
- A compacted soil structure will stay compacted.
- Consequently the tree suffers and will show signs of branch die-back
- Symptoms such as die-back may take several years to appear.
- Soil compaction over roots can be prevented by maintaining a fenced exclusion zone over the tree roots.
- The exclusion zone is calculated using British Standard 5837.
- Protective Fencing is installed around the calculated area.
- Protective Fencing is a condition of planning approval, if it is removed or repositioned the construction firm is in breach of a condition and may be subjected to legal action.

Trees for removal to be identified from the drawing and marked by an arboriculturist.

No vehicles to enter the grass verge or root protection zone during tree removal or fencing installation/removal.

Fencing to be installed prior to any construction works (including demolition, materials delivery, works compound installation).

The location of the tree protective fencing is indicative only and must not be directly measured from this plan. Its true location must be surveyed accurately on site and where applicable be measured from the tree centre by the stated dimension value.


Fencing to remain in place until all construction works have ceased.

6.2.2.3 Where the site circumstances and associated risk of damaging incursion into the RPA do not necessitate the default level of protection, an alternative specification should be prepared by the project arboriculturist and, where relevant, agreed with the local planning authority.

For example, 2 metre tall welded mesh panels on rubber or concrete feet might provide an adequate level of protection from cars, vans, pedestrians and manually operated plant. In such cases, the fence panels should be joined together using a minimum of two anti-tamper couplers, installed so that they can only be removed from inside the fence. The distance between the fence couplers should be at least 1 m and should be uniform throughout the fence. The panels should be supported on the inner side by stabilizer struts, which should normally be attached to a base plate secured with ground pins. Where the fencing is to be erected on retained hard surfacing or it is otherwise unfeasible to use ground pins, e.g. due to the presence of underground services, the stabilizer struts should be mounted on a block tray. (See Diagram Below)




- The major cause of damage to trees on construction sites is due to soil compaction.
- Roots use the spaces between soil particles to obtain the Oxygen, Water and Nutrients.
- Heavy plant and machinery compresses (compacts) the soil, squeezing out the air spaces and preventing root function.
- A compacted soil structure will stay compacted.
- Consequently the tree sufflers and will show signs of branch die-back.
- Symptoms such as die-back may take several years to appear.
- Soil compaction over roots can be prevented by maintaining a fenced exclusion zone over the tree roots.
- The exclusion zone is calculated using British Standard 5837.
- Protective Fencing is installed around the calculated area.
- Protective Fencing is a condition of planning approval. If it is removed or repositioned the construction firm is in breach of a condition and may be subjected to legal action.

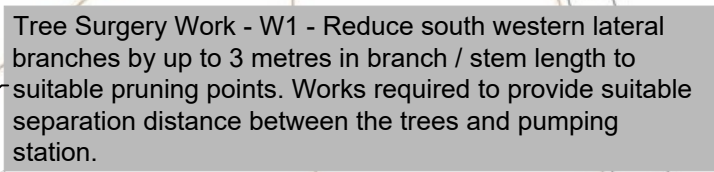

Tree Surgery Work - T200 - Retrenchment pruning, reduce western laterals branches by Approx 6 metres in branch length and other branches by approximate 4 metres in branch length to form a more compact retrenched tree to prolong the life of this tree

Tree Surgery Work - G12 + G13 - Reduce northern western lateral branches by 2.5 metres in branch length to suitable pruning points. Works required to provide suitable separation distance between the trees and dwellings.

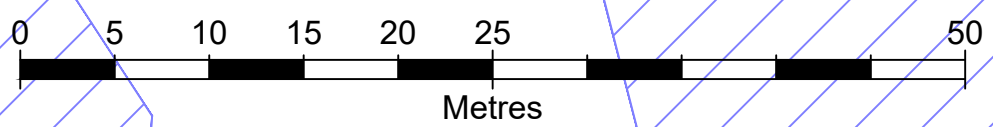

Site - Meadow Road
Project Ref - 717.11
Scale 1:400 @ A1

Temporary Tree Protective Fencing (High Risk) - (Not to be altered without prior approval from the Local Planning Authority)

Temporary Tree Protective Fencing (Low Risk) - (Not to be altered without prior approval from the Local Planning Authority)

 Low quality trees to be removed to facilitate construction work (See Section 5.2 for details)

 Poor quality trees to be removed due to poor health
(See Section 5.2 for details)

Moderate quality tree group to be removed to facilitate construction work
(See Section 5.2 for details)

Poor quality tree group to be removed due to poor health
(See Section 5.2 for details)

Trees surgery operations required - to BS3998:2010
:Tree works Recommendation
(See Section 5.4 for details)



Permanent Ground protection
- NO DIG - 3D Cellular confinement system (Geoweb / Cellweb product) with permeable surfacing used for the construction of the footpath during the landscaping phase.



Temporary Ground protection within RPA - Layer of geotextile fabric laid onto the grass, 150mm of Clean wood chip applied on top and inter-linking ground protection boards secured in place

out under the supervision of an Arboriculturist (Clean root pruning, use of hand tools, airspade and toothless buckets on small excavator (2500kg)

Please Note:
Arboricultural Method Statement:
MUST be followed in sequence, include site supervision by an Arboriculturist where specified and adhered to at all times. Details can be found in Section 6 of this report. Noncompliance with this method statement may result in planning enforcement action or prosecution.

10.0 Appendix 5 – Tree Photographs

Tree ID#G6



Tree ID#G5



Tree ID#G5



Tree ID#G2



Tree ID#T1



Tree ID#T188



Tree ID#T190



Tree ID#T192 + T191



Tree ID#T193



Tree ID#T194



Tree ID#G7



Tree ID#T195



Tree ID#G8 – Northern Horse Chestnut tree in group with slightly sparse upper leaf cover and small fungal fruiting body noted on trunk



Tree ID#T196



Tree ID#T196 - most areas of surface roots and buttress cover with *Perenniporia fraxinea* fungi



Tree ID#T196- most areas of surface roots and buttress cover with *Perenniporia fraxinea* fungi



Tree ID#G9



Tree ID#T198



Tree ID#G12



Tree ID#G1



Tree ID#T199



Tree ID#T200



Tree ID#T200



Tree ID#T200



Tree ID#G10



Tree ID#T201



Tree ID#G11



Tree ID#G11



Tree ID#T203-T206



Tree ID#T203 + T205



Tree ID#T205



Tree ID#T203



Tree ID#T206



Tree ID#W3



Tree ID#W1



Tree ID#W3



Tree ID#W3



Tree ID#W2



