
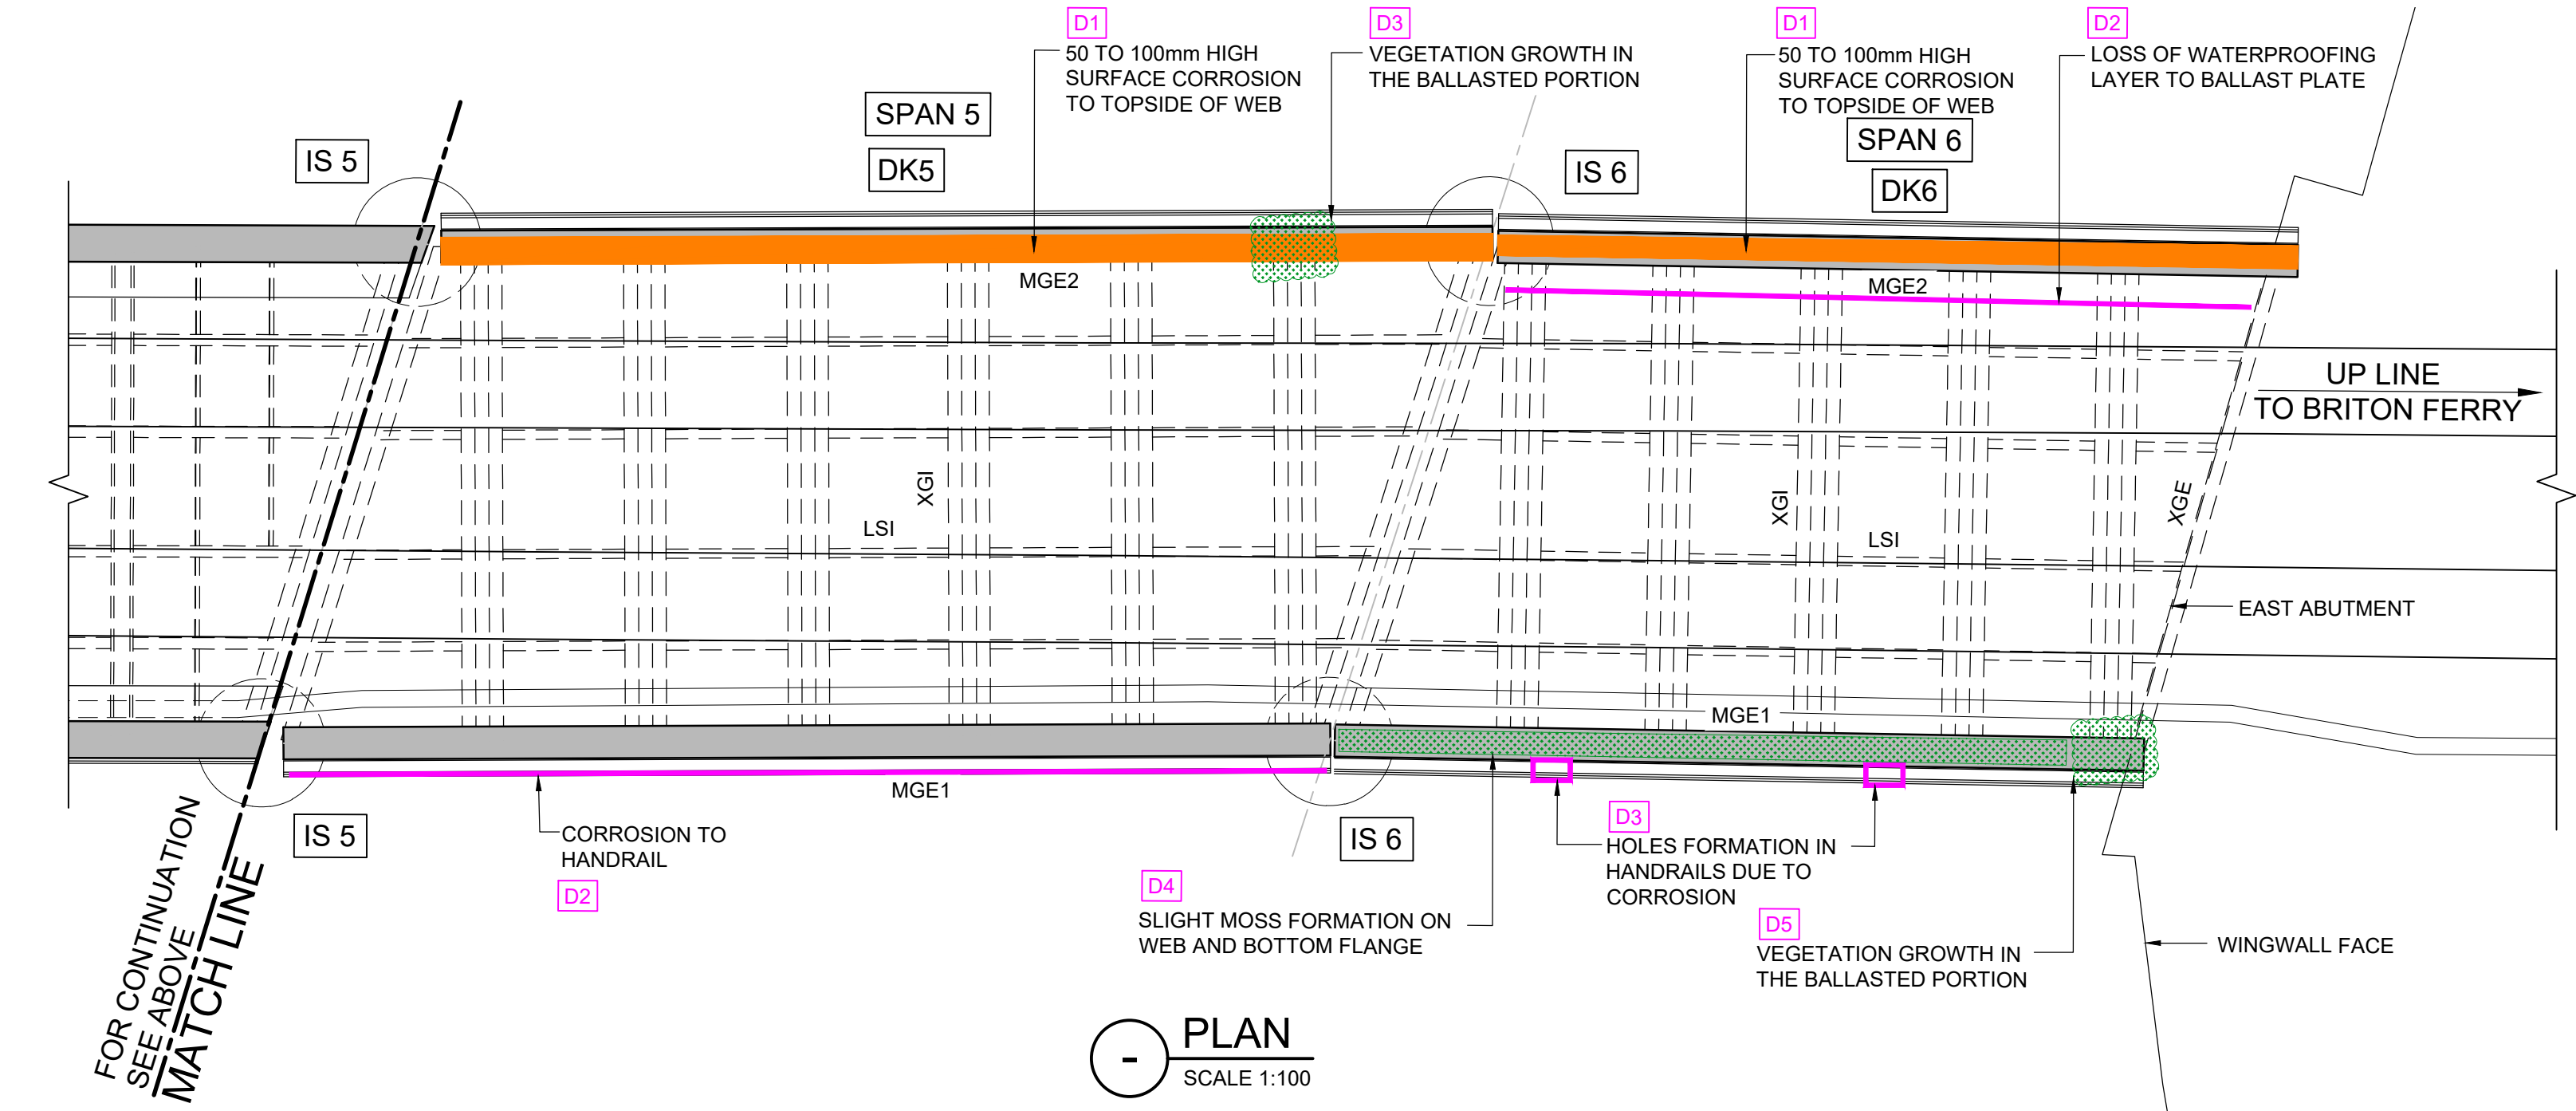
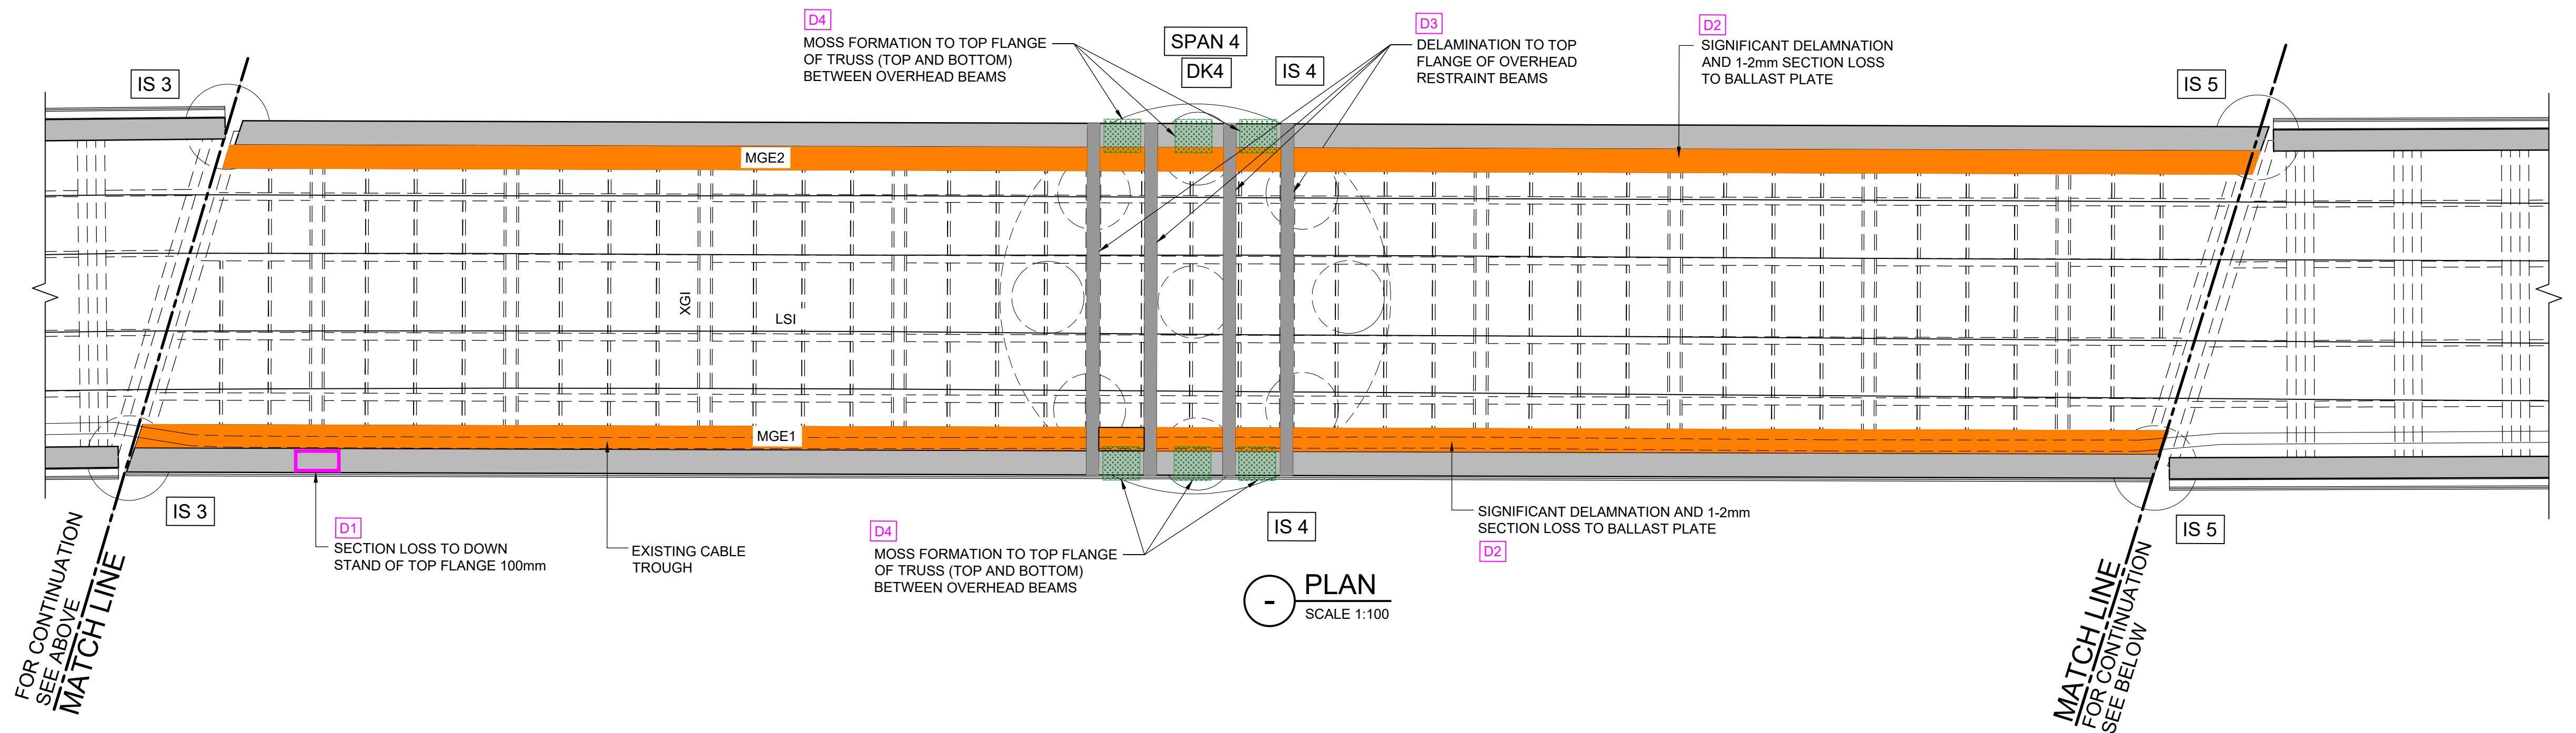
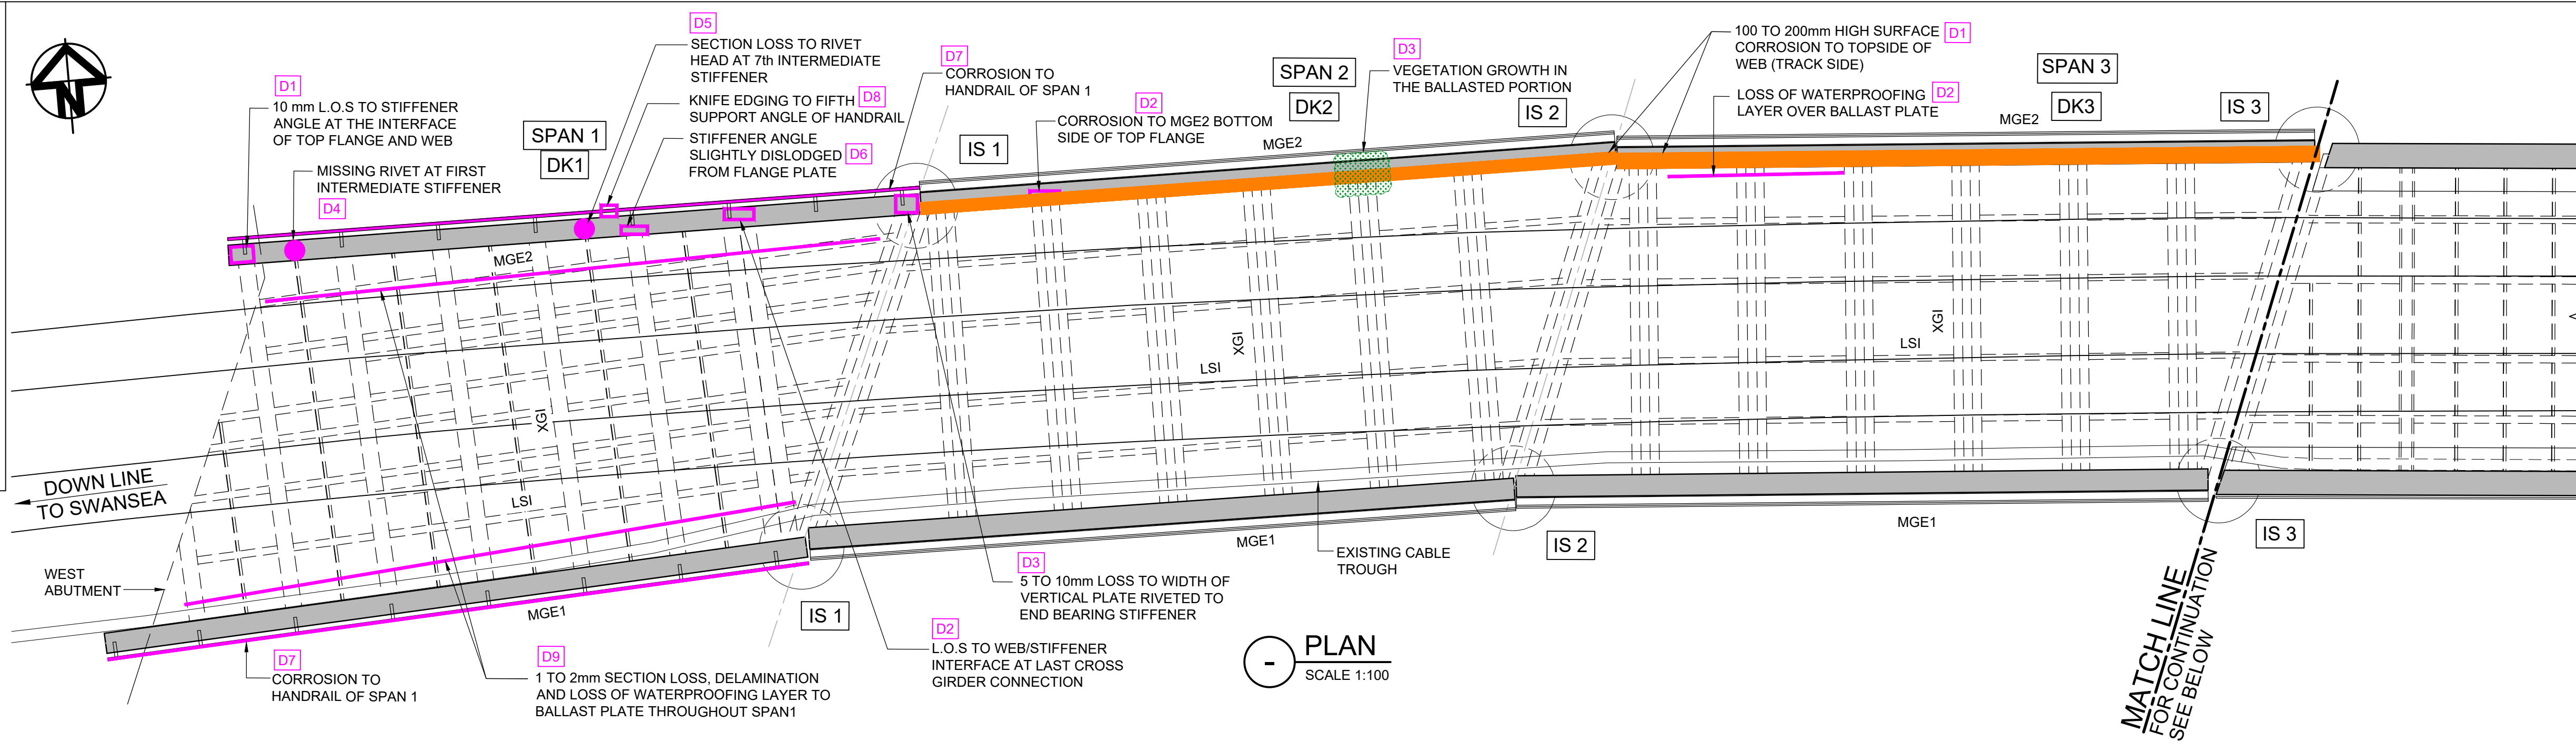


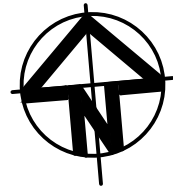


- NOTES:**
- ALL DIMENSIONS ARE IN MILLIMETRES AND LEVELS ARE IN METRES ADD UNLESS NOTED OTHERWISE.
 - DO NOT SCALE OFF THIS DRAWING, USE FIGURED DIMENSION ONLY.
 - THIS DRAWING HAS BEEN PREPARED BASED ON NETWORK RAIL ARCHIVE DRAWING No. MF1386, MF16279, MF13787, MF39241, MF13789, MF38862, MF38863, MF38865, MF38864 MF38859.
 - THIS DRAWING SHALL BE READ IN CONJUNCTION WITH DRAWINGS:
152093-ARC-DRG-ECV-000002,
152093-ARC-DRG-ECV-000003,
152093-ARC-DRG-ECV-000005 &
152093-ARC-DRG-ECV-000006.
 - REFER TO DRAWING NO. 152093-ARC-DRG-ECV-000030 FOR TABLE OF DEFECTS.
 - THIS DRAWING HAS BEEN PREPARED BASED ON TOPOGRAPHICAL SURVEY UNDERTAKEN BY PBH SURVEYS IN JANUARY 2020 ON BEHALF OF ARCADIS CONSULTING (UK) LIMITED.

LEGEND:-

	SURFACE RUST RASH
	GENERAL DEFECTS
	VEGETATION / MOSS GROWTH

- GENERAL INSPECTION NOTES :-**
- DELAMINATION AND LOSS OF SECTION TO BALLAST PLATE AT EDGES;
 - ACCUMULATION OF DEBRIS IN THE JOINTS BETWEEN ADJACENT DECKS;
 - LOSS OF PAINT WORK TO TOP FLANGE OF BRIDGE GIRDERS.
- L.O.S - LOSS OF SECTION

NOTE: D1, D2, ... - DEFECT NUMBERING

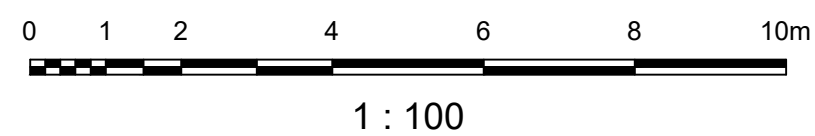

A03	24.04.2020	FOR FORM 001 REVIEW	K.S	B.K	J.L
A02	05.02.2020	FOR FORM BA REVIEW	D.K	B.K	J.L
A01	29.01.2019	FOR FORM AA REVIEW	D.K	B.K	J.L
Rev	Date	Description of Revisions	Drawn	Chkd	Appr
Status					Suitability

FOR FORM 001 REVIEW

S3



Contractor(s):



Project:

RIVER NEATH SWING
BRIDGE GRIP 4

Drawing Title:

TOP OF
DECK DEFECTS

Designed	S. ALURU	Signed	S.A	Date	24.04.2020
Drawn	K. SRILEKHA	Signed	K.S	Date	24.04.2020
Checked	B. KING	Signed	B.K	Date	24.04.2020
Approved	J. LYNN	Signed	J.L	Date	24.04.2020

Scale(s)
AS SHOWN @ A1
SDI1 207m 63ch

Alternative Reference
152093

Drawing Number
152093-ARC-DRG-ECV-000004

Sheet
1 of 1

Revision
A03