


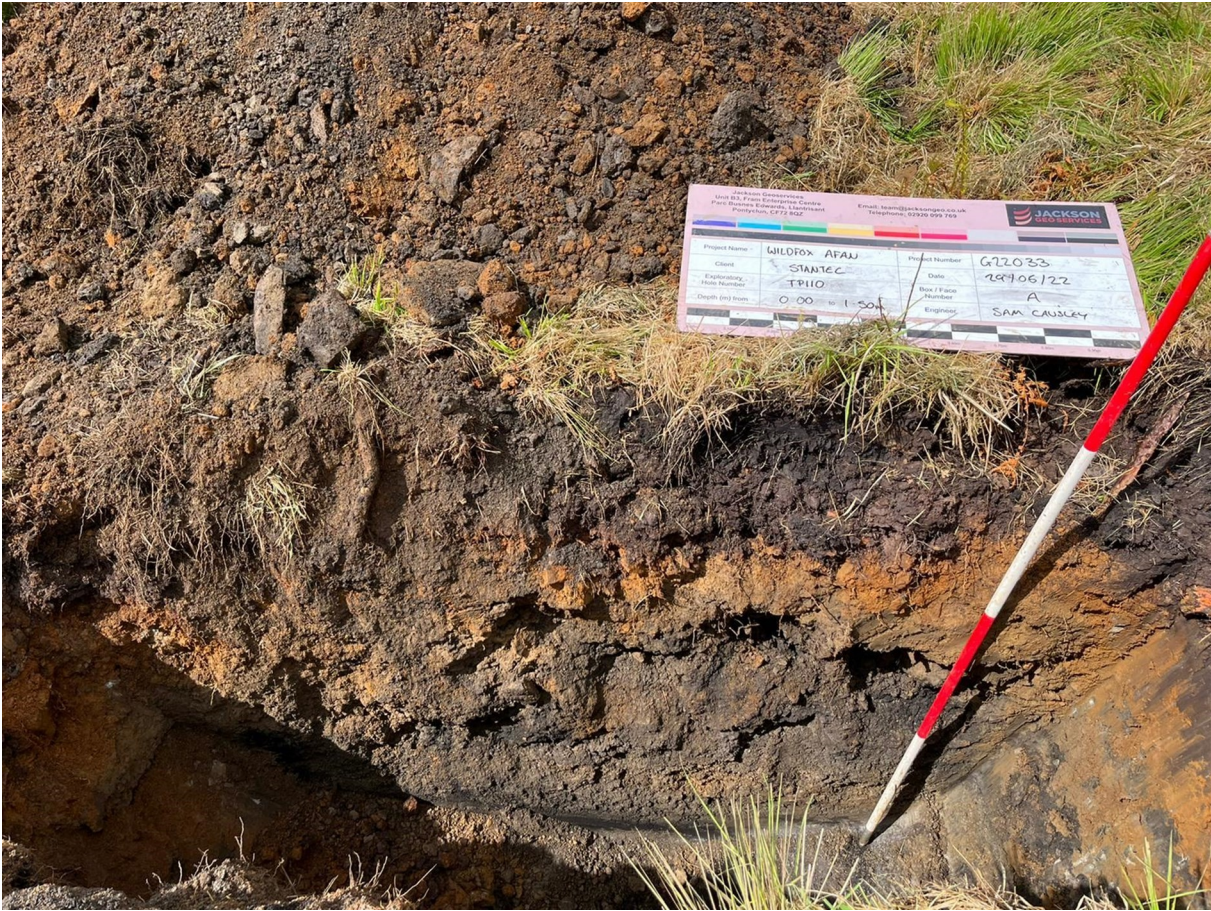
		EXPLORATORY HOLE PHOTOGRAPHS		Remarks Machine excavated trial pit from GL to 1.60m. No groundwater encountered. 3 soakaway testing cycles in accordance with BRE365 was completed. Backfilled with arisings.		Exploratory Hole
						TP109
Project	Afan Valley Adventure Resort	Easting	286268.57	Equipment	13 tonne tracked excavator	Sheet 2 of 2
Client	Wildfox Resorts - Afan Valley	Northing	195612.34	Method	TP	
Project No	G22033	Level	278.27 mAOD	Termination Reason	Terminated at scheduled depth	



TP109 Face B

		TRIAL PIT EXPLORATORY HOLE LOG						Exploratory Hole Progress by Time			Exploratory Hole		
								Date and Time		Depth	Water Depth	TP110	
								29/06/2022 10:15 29/06/2022 10:40		0.00 1.50	Dry		
Project	Afan Valley Adventure Resort			Equipment	13 tonne tracked excavator					Sheet 1 of 1			
Client	Wildfox Resorts - Afan Valley			Method	TP					Scale	1:20		
Project No	G22033	Level	305.11 mAOD	Orientation		130 degrees				Logged	SC		
Easting	286299.74	Northing	195412.90	Length		2.30				Checked	AP		
Termination Reason		Terminated at scheduled depth			Width		0.70						
Samples	Sampling and Testing Depths	Insitu Testing and Depth Related Remarks		Depth (Thickness)	Level (mAOD)	Legend	Description			Scale	Backfill		
1 D	0.50 - 0.60			0.00	304.71		Dark brown soft slightly sandy organic SILT with abundant rootlets (TOPSOIL)			0.50			
				(0.40)			Orangish brown slightly gravelly silty CLAY. Gravel is subrounded fine to medium of sandstone. (Weathered RHONDDA MEMBER)						
2 D	1.10 - 1.40			0.40	304.11		Greyish brown with occasional black very clayey gravelly medium to coarse SAND with low cobble content. Gravel is subangular to subrounded fine to coarse of sandstone and rare lignite. Cobbles are subangular of sandstone. (Weathered RHONDDA MEMBER)			1.00			
				(0.60)			End of Exploratory Hole at 1.50m			1.50			
				1.00	303.61					2.00			
				(0.50)						2.50			
										3.00			
										3.50			
										4.00			
Weather	Overcast	Trial Pit Excavation Onsite Layout 					Water Strikes						
Shoring	None						Date and Time		Strike	Rising to	Time	Remarks	
Stability	Stable												
Remarks													
Machine excavated trial pit from GL to 1.50m. No groundwater encountered. 1 soakaway testing cycle in accordance with BRE365 was completed. Backfilled with arisings.													

		EXPLORATORY HOLE PHOTOGRAPHS			Remarks Machine excavated trial pit from GL to 1.50m. No groundwater encountered. 1 soakaway testing cycle in accordance with BRE365 was completed. Backfilled with arisings.		Exploratory Hole
							TP110
Project	Afan Valley Adventure Resort	Easting	286299.74	Equipment	13 tonne tracked excavator	Sheet 1 of 2	
Client	Wildfox Resorts - Afan Valley	Northing	195412.90	Method	TP		
Project No	G22033	Level	305.11 mAOD	Termination Reason	Terminated at scheduled depth		



TP110 Face A






TP110 Face B

		EXPLORATORY HOLE PHOTOGRAPHS		Remarks Machine excavated trial pit from GL to 1.50m. No groundwater encountered. 1 soakaway testing cycle in accordance with BRE365 was completed. Backfilled with arisings.		Exploratory Hole
						TP110
Project	Afan Valley Adventure Resort	Easting	286299.74	Equipment	13 tonne tracked excavator	Sheet 2 of 2
Client	Wildfox Resorts - Afan Valley	Northing	195412.90	Method	TP	
Project No	G22033	Level	305.11 mAOD	Termination Reason	Terminated at scheduled depth	



TP110 Spoil

				TRIAL PIT EXPLORATORY HOLE LOG				Exploratory Hole Progress by Time			Exploratory Hole	
Date and Time		Depth	Water Depth					TP111				
29/06/2022 14:45 29/06/2022 15:15		0.00 1.50	Dry	Sheet 1 of 1								
Project	Afan Valley Adventure Resort			Equipment	13 tonne tracked excavator							
Client	Wildfox Resorts - Afan Valley			Method	TP							
Project No	G22033	Level		296.88 mAOD	Orientation	130 degrees						
Easting	286382.26	Northing	195464.88	Length	3.00	Scale	1:20					
Termination Reason		Terminated at scheduled depth		Width	0.80	Logged	SC					
						Checked	AP					
Samples	Sampling and Testing Depths	Insitu Testing and Depth Related Remarks	Depth (Thickness)	Level (mAOD)	Legend	Description		Scale	Backfill			
1 D	0.30 - 0.50		0.00	296.38		Greyish brown clayey gravelly fine to medium SAND. Gravel is subangular fine to coarse of sandstone. (Weathered RHONDDA MEMBER)		0.50				
			(0.50)									
2 B	1.20 - 1.40		0.50	295.28		Greyish brown slightly clayey sandy angular to subangular fine to coarse GRAVEL of sandstone with high cobble content and low boulder content. Cobbles are angular to subangular of sandstone with occasional dark red staining. Boulders are angular (400 to 600mm) of sandstone with dark red staining. (Weathered RHONDDA MEMBER)		1.00				
			(1.10)									
						End of Exploratory Hole at 1.60m		1.50				
								2.00				
								2.50				
								3.00				
								3.50				
								4.00				
Weather	Overcast	Trial Pit Excavation Onsite Layout 				Water Strikes						
Shoring	None					Date and Time		Strike	Rising to	Time	Remarks	
Stability	Stable											
Remarks												
Machine excavated trial pit from GL to 1.60m. No groundwater encountered. 4 soakaway testing cycles in accordance with BRE365 was completed. Backfilled with arisings.												

Printed 08/08/2022 15:49